

Safety Data Sheet



1. PRODUCT AND COMPANY IDENTIFICATION:

PRODUCT NAME: 1282

MANUFACTURER: Selectrode Industries, Inc.
230 Broadway
Huntington Station, NY 11746 U.S.A.
Phone: 631-547-5470
Fax: 631-547-5475
E-mail: info@selectrode.com

EMERGENCY TELEPHONE NUMBER: 631-547-5470

2. HAZARD IDENTIFICATION:

Emergency Overview: This product is normally not considered hazardous as shipped. Avoid eye contact or inhalation of dust from the product. When this product is used in a welding process, the most important hazards are welding fumes, heat, radiation and electric shock.

Classification of the Substance/Mixture

CLP/GHS Classification (1272/2008):

Skin Irritation, Category 2

Eye Irritation, Category 2A

Specific Target Organ Toxicity (Single Exposure), Category 3

Hazardous to the Aquatic Environment – Acute Hazard, Category 1

EU Classification (67/548/EEC):

Irritant (Xi), Dangerous for the Environment (N), R36/37/38, R50

Hazardous Classification per 29CFR 1910.1200 (Rev. July 1, 2012):

Skin Irritation, Category 2

Eye Irritation, Category 2A

Specific Target Organ Toxicity (Single Exposure), Category 3

Hazardous to the Aquatic Environment – Acute Hazard, Category 1

Labelling:

Symbols:  

Signal Word: Warning

Hazard Statements:

H315 – Causes skin irritation.

H319 – Causes serious eye irritation.

H335 – May cause respiratory irritation.

H400 – Very toxic to aquatic life

Precautionary Statements:

P210 – Keep away from heat/sparks/open flames/hot surfaces – No smoking.

P261 – Avoid breathing dust/fume/gas/mist/vapours/spray.

P264 – Wash skin and hair thoroughly after handling.

P271 – Use only outdoors or in a well-ventilated area.

P273 – Avoid release to the environment.

P280 – Wear protective gloves/eye protection/face protection.

P302+P352 – IF ON SKIN: Wash with plenty of soap and water.

**Safety
Data
Sheet**



P304+P340 – IF INHALED: Remove victim to fresh air and keep at rest in a position comfortable for breathing.

P305+P351+P338 – IF IN EYES: Rinse cautiously with water for several minutes. Remove contact lenses, if present and easy to do. Continue rinsing.

P312 – Call a POISON CENTER or doctor/physician if you feel unwell.

P332+P313 – IF skin irritation occurs: Get medical advice/attention.

P337+P313 – IF eye irritation persists: Get medical advice/attention.

P362 – Take off contaminated clothing and wash before reuse.

P391 – Collect spillage.

P403+P233 – Store in a well-ventilated place. Keep container tightly closed.

P405 – Store locked up.

P501 – Dispose of contents/container in accordance with local/regional/national/international regulations.

3. COMPOSITION / INFORMATION ON INGREDIENTS:

| Chemical Identity | CAS # | Range % | OSHA PEL (mg/m3) | ACGIH-TLV (mg/m3) | Carcinogenicity | EU Classification (67/548/EEC) | CLP/GHS Classification (1272/2008) | Hazardous Classification per 29CFR 1910.1200 (Rev. July, 2012) |
|-------------------|-----------|---------|------------------|-------------------|-----------------|--------------------------------|--|--|
| #Copper | 7440-50-8 | 70-80 | 1.0 | 1.0 | No | F) R11 (N) R50 | (H228) Flam. Sol. 1 (H400) Aquatic Acute 1 | (H228) Flam. Sol. 1 (H400) Aquatic Acute 1 |
| Barium Carbonate | 513-77-9 | 1-11 | 0.5 | 0.5 | No | (Xn) R22 | (H302) Acute Tox. 4 | (H302) Acute Tox. 4 |
| Sodium Silicate | 1344-09-3 | 1-11 | NR | 5 | No | (C) R34 (Xi) R37 | (H314) Skin Corr. 1B (H335) STOT SE 3 | (H314) Skin Corr. 1B (H335) STOT SE 3 |
| Calcium Carbonate | 1317-65-3 | 1-11 | 5 (as CaO) | 10 | No | Not Dangerous | Not Hazardous | Not Hazardous |
| Calcium Fluoride | 7789-75-5 | 1-11 | 2.5 (as F) | 2.5 (as F) | No | (Xi) R36/37/38 | (H315) Skin Irrit. 2 (H319) Eye Irrit. 2A (H335) STOT SE 3 | (H315) Skin Irrit. 2 (H319) Eye Irrit. 2A (H335) STOT SE 3 |
| Graphite | 7782-42-5 | 1-5 | 15 | 2 | No | (Xi) R36/37 | (H319) Eye Irrit. 2A (H335) STOT SE 3 | (H319) Eye Irrit. 2A (H335) STOT SE 3 |
| Iron Carbonate | 563-71-3 | 1-5 | 1 | 1 | No | Not Dangerous | Not Hazardous | Not Hazardous |
| #Tin | 7440-31-5 | 1-11 | 2 | 2 | No | Not Dangerous | Not Hazardous | Not Hazardous |

Important This section covers the materials of which the products manufactured. The fumes and gases produced during normal use of this product are covered in section 10. The term "Hazardous" in "Hazardous Material" should be interpreted as a term required and defined in OSHA Hazard Communication Standard 29CFR 1910-1200 and it does not necessarily imply the existence of hazard. The chemicals or compounds reportable by Section 313 of SARA are marked by the symbol #.

4. FIRST AID MEASURES:

Inhalation: Remove to fresh air immediately or administer oxygen. Get medical attention immediately.

Skin: Flush skin with large amounts of water. If irritation develops and persists, get medical attention.


Eye: Flush eyes with water for at least 15 minutes. Get medical attention.

Ingestion: Obtain medical attention immediately if ingested.

Electric Shock: Disconnect and turn off the power. Use a nonconductive material to pull victim away from contact with live parts or wires. Immediately contact a physician.

5. FIRE-FIGHTING MEASURES:

**Safety
Data
Sheet**

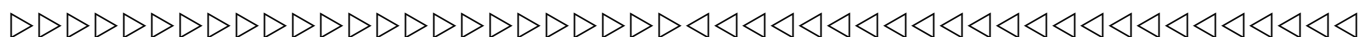

Suitable Extinguishing Media: Use water spray, alcohol-resistant foam, dry chemical or carbon dioxide. Welding arcs and sparks can ignite combustible and flammable materials. Use the extinguishing media recommended for the burning material and fire situation.

Unsuitable Extinguishing Media: Not applicable

Specific Hazards Arising From Chemical: Copper oxides, Carbon oxides, Barium oxide, Sodium oxides, Silicon oxides, Hydrogen fluoride, Calcium oxide, Carbon oxides, Iron oxides, Tin oxides

Protective Equipment: Fire fighters should wear complete protective clothing including self-contained breathing apparatus.

6. ACCIDENTAL RELEASE MEASURES:

Personal Precautions: Refer to section 8.

Environment Precautions: Refer to section 13.

Cleaning Measures: Solid objects may be picked up and placed into a container. Liquids or pastes should be scooped up and placed into a container. Wear proper protective equipment while handling these materials. Do not discard as refuse.

7. HANDLING AND STORAGE:

Precautions for Safe Handling: Handle with care to avoid stings or cuts. Wear gloves when handling welding consumables. Avoid exposure to dust. Do not ingest. Some individuals can develop an allergic reaction to certain materials. Retain all warning and identity labels.

Conditions for Safe Storage: Store in dry place in closed packages. Keep separate from chemical substances like acids and strong bases, which could cause chemical reactions.

8. EXPOSURE CONTROLS/ PERSONAL PROTECTION:

Engineering Controls: Avoid exposure to welding fumes, radiation, spatter, electric shock, heated materials and dust. Ensure sufficient ventilation, local exhaust, or both, to keep welding fumes and gases from breathing zone and general area. Keep work place and protective clothing clean and dry. Train welders to avoid contact with live electrical parts and insulate conductive parts. Check condition of protective clothing and equipment on a regular basis.

Exposure limits: Use industrial hygiene equipment to ensure that exposure does not exceed applicable national exposure limits. The limits defined under section 3 can be used as guidance. Unless noted, all values are for 8 hour time weighted average. For information about welding fume analysis refer to section 10.

Biological limits: No available data

Personal protection:

Respiratory protection: Use an air purifying dust respirator when welding or brazing in a confined space, or when local exhaust or ventilation is not sufficient to keep exposure values within safe limits.

Hands protection: Wear appropriate gloves to prevent skin contact.

EN 12477: Protection gloves for welders

| Requirements (EN Levels) | Type A | Type B |
|--------------------------|---------|---------|
| Abrasion (Cycles) | 2 (500) | 1 (100) |
| Cut (Factor) | 1 (1.2) | 1 (1.2) |
| Tear (Newton) | 2 (25) | 1 (10) |
| Puncture (Newton) | 2 (60) | 1 (20) |
| Burning Behaviour | 3 | 2 |
| Contact Heat | 1 | 1 |
| Convective Heat | 2 | - |
| Small Splashes | 3 | 2 |
| Dexterity | 1 (11) | 4 (6.5) |

**Safety
Data
Sheet**



Type B gloves are recommended when high dexterity is required as for TIG welding, while type A gloves are recommended for other welding processes. The contact temp (°C) is 100 and the threshold time (seconds) >15.

Eyes protection: Welder's helmet or face shield with colour absorbing lenses. Shield and filter to provide protection from harmful UV radiation, infra-red and molten metal approved to standard EN379. Filter shade to be a minimum of shade 9.

Skin protection: Heat-resistant protective clothing. Wear safety boots, apron, arm and shoulder protection. Keep protective clothing clean and dry. Clothing should be selected to suit the level, duration and purpose of the welding activity.

| Class 1 | |
|---------------------------|---|
| Impact of Spatter | 15 Drops |
| Heat Transfer (radiation) | RHTI 24 ≥ 7 seconds |
| Process | <p>Manual welding with light formation of spatter and drops</p> <ul style="list-style-type: none"> • Gas Welding • TIG Welding • MIG Welding • Micro plasma welding • Brazing • Spot Welding • MMA Welding (with rutile-covered electrode) |
| Environmental Conditions | <p>Operation of machines</p> <ul style="list-style-type: none"> • Oxygen cutting machines • Plasma cutting machines • Resistance welding machines • Machines for thermal spraying • Bench welding |

| Class 2 | |
|---------------------------|--|
| Impact of Spatter | 25 Drops |
| Heat Transfer (radiation) | RHTI 24 ≥ 16 seconds |
| Process | <p>Manual welding with heavy formation of spatter and drops</p> <ul style="list-style-type: none"> • MMA welding (with basic or cellulose-covered electrodes) • MAG welding (with CO2 or mixed gases) • MIG Welding (with high current) • Self-shielded flux core arc welding • Plasma cutting • Gouging • Oxygen cutting • Thermal spraying |
| Environmental Conditions | <p>Operation of machines</p> <ul style="list-style-type: none"> • In confined spaces • At overhead welding/cutting or in comparable constrained positions |

9. PHYSICAL AND CHEMICAL PROPERTIES:

Appearance: Solid.

Color: Dark Brown

Odour: Odourless

Odour Threshold: Not Available

pH Value: Not Available

Melting Point/Melting Range: 1560 - 2000° F, 850 - 1100° C

Freezing Point: Not Available

**Safety
Data
Sheet**



Boiling Point/Boiling Range: Not Available

Flash point: Not Available

Evaporation Rate: Not Available

Self-in flammability: Not Available

Explosion limits: Not Available

Vapour pressure: Not Available

Vapour density: Not Available

Density at 20°C: Not Available

Relative density: 6-9 g/cm³

Solubility: Insoluble in water.

Partition coefficient: Not Available

Auto-ignition temperature: Not Available

Decomposition temperature: Not Available

Other Information: No available data.

10. STABILITY AND REACTIVITY:

Chemical Stability: This product is stable under normal conditions.

Hazardous Reactions: Contact with chemical substances like acids or strong bases cause generation of gas.

Conditions to Avoid: Copper can form an unstable acetylide if in contact with acetylene gas.

Incompatible Materials: Strong Oxidizers; Ammonia; Azides; Bromates; Chlorates, and Iodates of Alkali and Alkali Earth Metals; Halogens; Alkaline Hydroxides. Reacts with acids

Hazardous Decomposition Products: When this product is used in a welding process, hazardous decomposition product would include those from volatilization, reaction or oxidation of the material listed in section 3 and those from the base metal and coating. The amount of fumes generated from this product varies with welding parameters and dimensions.

Refer to applicable national exposure limits for fume compounds, including those exposure limits for fume compounds found in section 3. Reasonably expected gaseous products would include carbon oxides, nitrogen oxides and ozone. Air contaminants around the welding area can be affected by the welding process and influence the composition and quality of fumes and gases produced.

11. TOXICOLOGICAL INFORMATION:

Signs and Symptoms of Overexposure: Inhalation of welding fumes and gases can be dangerous to your health. Classification of welding fumes is difficult because of varying base materials, coatings, air contaminants and processes. The Internal Agency for Research on Cancer has classified welding fumes as possible carcinogenic to humans (Group 2B).

Acute Effects: Overexposure to welding fumes may result in symptoms like metal fume fever, dizziness, nausea, dryness or irritation of the nose, throat or eyes. Tin: May cause skin irritation. May cause eye irritation due to mechanical action. Inhalation of tin dust may cause respiratory tract and mucous membrane tract irritation due to mechanical action. It is poorly absorbed from the digestive tract. It can cause gastrointestinal tract disturbance which may be irritant or astringent on the stomach. Symptoms of systematic copper poisoning may include: capillary damage, headache, cold sweat, weak pulse, kidney and liver damage, central nervous system excitation followed by depression, jaundice, convulsions, paralysis and coma.

| LD/LC50 Values that are relevant for classification | | |
|---|------|-----------------------|
| Copper 7440-50-8 | | |
| Oral | LD50 | >2000 mg/kg (rat) |
| Dermal | LD50 | >2000 mg/kg (rat) |
| Inhalation | LC50 | >5.11 mg/L/4 hr (rat) |
| Intraperitoneal | LD50 | 3.5 mg/kg (mouse) |

| LD/LC50 Values that are relevant for classification | | |
|---|--|--|
| Barium Carbonate 513-77-9 | | |

**Safety
Data
Sheet**



| | | |
|------|------|---------------------------------|
| Oral | LD50 | 418 mg/kg (rat) |
| | LC50 | 6950 mg/l (96h) (mosquito fish) |

| | | |
|---|------|--------------------|
| LD/LC50 Values that are relevant for classification | | |
| Calcium Carbonate 1317-65-3 | | |
| Oral | LD50 | >2000 mg/kg (rat) |
| Inhalation | LC50 | >3 mg/L/4hr. (rat) |
| Dermal | LD50 | >2000 mg/kg (rat) |

| | | |
|---|------|--------------------------------------|
| LD/LC50 Values that are relevant for classification | | |
| Calcium Fluoride 7789-75-5 | | |
| Oral | LD50 | >2000 mg/kg (rat) |
| Inhalation | LC50 | >5070 mg/m ³ /4 hr. (rat) |

Chronic Effects: Overexposure to welding fumes may affect pulmonary function. Chronic copper poisoning is typified by hepatic cirrhosis, brain damage and demyelination, kidney defect and copper deposition in the cornea as exemplified by humans with Wilson’s disease. It has also been reported that copper poisoning has led to haemolytic anemia and accelerates arteriosclerosis, damage to the lungs, vomiting, diarrhoea, abdominal pain and blood disorders. Prolonged or repeated exposure to sodium fluoride can cause damage to the lungs.

12. ECOLOGICAL INFORMATION:

Toxicity: Welding rods contain metals which are considered to be very toxic towards aquatic organisms. Finely divided welding rods are therefore considered harmful to aquatic organisms.

Persistence and Degradability: The welding rods consist of elements that can not degrade any further in the environment.

Bio accumulative Potential: Welding rods contain heavy metals which bio accumulates in the food chain. The following figures are the bio concentration factor (BCF) for the substances on their own.

BCF:

Copper, BCF: 29

Mobility in Soil: Welding rods are not soluble in water or soil. Particles formed by working welding rods can be transported in the air.

Other Adverse Effects: In massive form, welding rods present no hazards to the aquatic environment.

Welding materials could degrade into components originating from the materials used in the welding process. Avoid exposure to conditions that could lead to accumulation in soils or groundwater. Harmful to aquatic organisms, may cause long-term adverse effects in the aquatic environment.

13. DISPOSAL CONSIDERATIONS:

Product: For product elimination, consult recycling companies or appropriate local authority.

USA RCRA: In their intended manner of use, this product should not be released into the environment and may cause long lasting harmful effects to aquatic life. Residue from welding consumables and processes could degrade and accumulate in soils and groundwater.

Package: May be disposed in approved landfills provided local regulations are observed.

14. TRANSPORT INFORMATION:

UN-number: Welding rods are not classified as dangerous goods for transport and has no UN number.

UN proper shipping name: Welding rods are not classified as dangerous goods for transport and has no UN proper shipping name.

Transport hazard class: Welding rods are not classified as dangerous goods for transport.

Packing group: There are not any special precautions with which a user should or must comply or be aware of in connection with transport or conveyance either within or outside premises.

**Safety
Data
Sheet**



Environmental hazards: Welding rods are not environmentally hazardous according to the criteria of the UN Model Regulations (as reflected in the IMDG Code, ADR, RID and AND) and/or a marine pollutant to the IMDG Code.

Special precautions for users: There are not any special precautions which a user should or must comply or be aware of in connection with transport or conveyance either within or outside premises of the welding rod.

Transport in Bulk According to Annex III MARPOL 73/78 and the IBC Code: Welding rods in massive form do not subject under MARPOL 73/78 and the IBC Code. Not applicable – product is transported only in packaged form.

15. REGULATORY INFORMATION:

Safety, health and environment regulations/legislation specific for the substance or mixture: Read and understand the manufacturer's instructions, your employer's safety practices and the health and safety instructions on the label. Observe any federal and local regulations. Take precautions when welding and protect yourself and others.

Warning: Welding fumes and gases are hazardous to your health and may damage lungs and other organs. Use adequate ventilation. Electric shock can kill. Arc rays and sparks can injure eyes and burn skin. Wear correct hand, head, eye and body protection.

Chemical safety assessment: No

USA: Under the OSHA Hazard Communication Standard, this product is considered hazardous.

CALIFORNIA PROPOSITION 65: No compounds present. (California Health & Safety Code § 25249.5 et seq.)

United States EPA Toxic Substance Control Act: All constituents of this product are on the TSCA inventory list or are excluded from listing.

EPCRA/SARA Title III Toxic Chemicals

The following metallic components are listed as SARA 313 "Toxic Chemicals" and potential subject to annual SARA reporting. See Section 3 for weight percentage.

| Ingredient Name | Disclosure Threshold |
|-----------------|----------------------|
| Copper | 1 mg/m3 |
| Tin | 2 mg/m3 |

16. OTHER INFORMATION:

The information in this document is believed to be correct as of the date issued. However, no warranty is expressed to be implied regarding the accuracy or completeness of this information. This information and product are furnished on the condition that the person receiving them shall make his own determinations as to the suitability of the product for his particular purpose and on the condition that he assumes the risk of his use thereof.

This Material Safety Data Sheet complies with the EC directives 91/155/EEC and 93/112/EEC, including modifications 2001/58/EC.

Complies with OSHA Communication Standard 29 CFR 1910.1200 and Superfund Amendments and Reauthorization Act (SARA) of 1986 Public Law 99-499

Hazard Statements:

- H228** – Flammable solid
- H302** – Harmful if swallowed.
- H314** – Causes severe skin burns and eye damage.
- H315** – Causes skin irritation.
- H319** – Causes serious eye irritation.
- H335** – May cause respiratory irritation.
- H400** – Very toxic to aquatic life

R-Phrases:

- R11** – Highly flammable
- R22** – Harmful if swallowed.
- R34** – Causes burns.

